



Indianapolis Power & Light Company  
Eagle Valley Generating Station

## Annual Inspection of CCR Surface Impoundments

Prepared by



55 East Monroe Street  
Chicago, IL 60603-5780 USA  
312-269-2000  
[www.sargentlundy.com](http://www.sargentlundy.com)

S&L Project No. 10572-112  
Rev. 0  
Issue Date: January 19, 2018  
Issue Purpose: Use

## LEGAL NOTICE

*This report (“Report”) was prepared by Sargent & Lundy LLC (“S&L”), in accordance with the agreement between S&L and Indianapolis Power & Light Company (“Client”). This Report was prepared using the degree of skill and care ordinarily exercised by engineers practicing under similar circumstances. Client acknowledges: (1) S&L prepared this Report subject to the particular scope limitations, budgetary and time constraints, and business objectives of the Client; (2) information and data provided by others may not have been independently verified by S&L; and (3) the information and data contained in this Report are time sensitive and changes in the data, applicable codes, standards, and acceptable engineering practices may invalidate the findings of this Report. Any use or reliance upon this Report by third parties shall be at their sole risk.*



**CERTIFICATION PAGE**

**ANNUAL INSPECTION OF  
CCR SURFACE IMPOUNDMENTS**


**AT THE  
EAGLE VALLEY GENERATING STATION  
INDIANAPOLIS POWER & LIGHT COMPANY**

I certify that this Report was prepared by me or under my direct supervision and that I am a registered professional engineer under the laws of the State of Indiana.

This Report is released for use under the authority of David Nielson, Indiana PE # 10300076 on January 19, 2018.

Certified by: David E. Nielson Date: 1-19-2018

Seal:

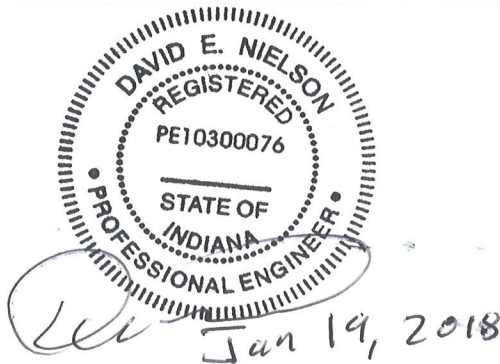



## TABLE OF CONTENTS

1	PURPOSE .....	1
2	INSPECTION OF EXISTING CCR SURFACE IMPOUNDMENTS .....	1
2.1	CHANGES IN GEOMETRY .....	1
2.2	REVIEW OF EXISTING INSTRUMENTATION .....	1
2.3	IMPOUNDMENT PARAMETERS .....	1
2.4	VISUAL INDICATION OF ACTUAL OR POTENTIAL STRUCTURAL WEAKNESSES ....	3
2.5	OTHER CHANGES .....	3
3	CONCLUSION .....	3

## 1 PURPOSE

Pursuant to 40 CFR 257.83(b)(2), this document provides the annual inspection report for the applicable existing coal combustion residual (CCR) surface impoundments at Indianapolis Power & Light Company (IPL) Eagle Valley Generating Station. The following applicable CCR units were visually inspected on November 29, 2017, by Mr. David Nielson, P.E. (Licensed in IN, IL, MI, NV, and WA):

- Pond A,
- Pond B, and
- Pond C.

## 2 INSPECTION OF EXISTING CCR SURFACE IMPOUNDMENTS

### **Federal CCR Rule Reference: 40 CFR 257.83(b)(1)(i), 257.83(b)(1)(ii)**

This annual inspection of the CCR surface impoundments included:

- 1) Review of previously generated information regarding the status and condition of each CCR surface impoundment, including, but not limited to, operating records, publicly accessible Internet site entries, design and construction drawings, and other documents and reports,
- 2) A visual inspection of the applicable CCR surface impoundments and appurtenant structures to identify signs of any distress or malfunction, and
- 3) A visual inspection of the accessible portions of known hydraulic structures underlying the base of the CCR surface impoundments and passing through the dike of the CCR surface impoundments for structural integrity and continued safe and reliable operation.

The following sections present the CCR surface impoundment inspection observations and findings.

### 2.1 CHANGES IN GEOMETRY

#### **Federal CCR Rule Reference: 40 CFR 257.83(b)(2)(i)**

No noticeable changes in geometry were observed while performing the visual inspection of dike surfaces of the CCR surface impoundments.

### 2.2 REVIEW OF EXISTING INSTRUMENTATION

#### **Federal CCR Rule Reference: 40 CFR 257.83(b)(2)(ii)**

Each CCR surface impoundment outlet structure is equipped with a staff gauge. Maximum staff gauge readings, since the previous annual inspection, are reported in Section 2.3. It should be noted that the ponds are generally dry and as such, the water level was below the staff gauges.

### 2.3 IMPOUNDMENT PARAMETERS

#### **Federal CCR Rule Reference: 40 CFR 257.83(b)(2)(iii), 257.83(b)(2)(iv), 257.83(b)(2)(v)**

Tables 1, 2 and 3 provide various measurable impoundment parameters required by 40 CFR 257.83(b)(2)(iii) through (v) that have been recorded since the last annual inspection in 2016 and at the time this annual inspection was performed.



**TABLE 1: APPROXIMATE DEPTH OF WATER AND WATER SURFACE ELEVATION OF CCR SURFACE IMPOUNDMENTS**

CCR Surface Impoundment	Minimum Depth <sup>1</sup> (ft)	Maximum Depth <sup>1</sup> (ft)	Present Depth <sup>2</sup> (ft)	Minimum Elevation <sup>1</sup> (ft)	Maximum Elevation <sup>1</sup> (ft)	Present Elevation <sup>2</sup> (ft)
Pond A	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>
Pond B	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>
Pond C	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>	NA <sup>3</sup>

Notes:

- 1) Since the previous annual inspection on November 2, 2016.
- 2) At time of inspection on November 29, 2017.
- 3) NA - Pond did not impound significant water at the time of the annual inspection nor during the prior year.

**TABLE 2: APPROXIMATE AVERAGE DEPTH OF CCR AND AVERAGE CCR SURFACE ELEVATION WITHIN CCR SURFACE IMPOUNDMENTS<sup>1</sup>**

CCR Surface Impoundment	Minimum Depth <sup>2</sup> (ft)	Maximum Depth <sup>2</sup> (ft)	Present Depth <sup>3</sup> (ft)	Minimum Elevation <sup>2</sup> (ft)	Maximum Elevation <sup>2</sup> (ft)	Present Elevation <sup>3</sup> (ft)
Pond A	23	23	23	625	625	625
Pond B	14	14	14	616	616	616
Pond C	9	9	9	611	611	611

Notes:

- 1) Depths and elevations presented are averages over the aerial extent of each impoundment.
- 2) Since the previous annual inspection on November 2, 2016.
- 3) At time of inspection on November 29, 2017.

**TABLE 3: APPROXIMATE STORAGE CAPACITY AND VOLUME  
OF IMPOUNDED WATER AND CCR AT TIME OF INSPECTION**

<b>CCR Surface Impoundment</b>	<b>Approximate Total Available Storage Capacity (ac-ft)</b>	<b>Approximate Actual Volume of Impounded Water (ac-ft)</b>	<b>Approximate Actual Volume of Impounded CCR (ac-ft)</b>
Pond A	406	< 5	386
Pond B	158	<5	136
Pond C	95	Dry	53

## **2.4 VISUAL INDICATION OF ACTUAL OR POTENTIAL STRUCTURAL WEAKNESSES**

### **Federal CCR Rule Reference: 40 CFR 257.83(b)(2)(vi)**

S&L observed the exposed interior and exterior slopes, exterior toe of slopes and crests of slopes for the applicable CCR surface impoundments and did not observe any evidence of existing conditions that are disrupting or could plausibly have the potential to disrupt the operation and safety of the applicable CCR surface impoundments.

S&L observed accessible pipes running through and below the dikes and ponds. S&L did not observe any evidence of existing conditions that are disrupting or could plausibly have the potential to disrupt the operation and safety of the applicable CCR surface impoundments.

## **2.5 OTHER CHANGES**

### **Federal CCR Rule Reference: 40 CFR 257.83(b)(2)(vii)**

No other changes were observed which may have affected the stability or operation of the CCR surface impoundments since the previous annual inspection.

## **3 CONCLUSION**

This annual inspection confirmed that the design, construction, operation, and maintenance of the applicable existing CCR surface impoundments at IPL's Eagle Valley Generating Station are consistent with recognized and generally accepted good engineering standards.